

# Manhole Inspection Summary

Manhole # S07YY1007MH

Printed On: 12/17/2008

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **07YY1** Node: **007** Status: **Found**

Insp Date: **9/20/06 8:38 PM**

Incomplete Comments

Crew: **WM, CH**  
Inspector: **Hale, C**  
Firm: **RKK**

**Location** Address: **2901 WHITNEY AVE**

Cross Street: **WOODCREST AVE**

**Manhole** Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments **The O12 pipe seal is not flush to the pipe.**

**Cover**

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick**

☐ Parged Height: **4** (in.)

Condition: ☐ Sound

☐ Cracked

☐ Root Intrusion

☒ **Loose Brick**

☒ **Deteriorated**

Infiltration: ☐ None

☒ **Joint**

☐ Cracks

☒ **Mortar**

☐ Roots

☐ Wall

**Corbel**

Material: **Concrete**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☐ None

☒ **Joint**

☐ Cracks

☐ Mortar

☐ Roots

☒ **Wall**

**Barrel**

Material: **Concrete**

☐ Parged

Shape: **Rectangular**

Diameter: **40** (in.) Length: **60** (in.)

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☐ None

☐ Joint

☐ Cracks

☐ Mortar

☐ Roots

☒ **Wall**

**Bench**

☒ Exists Material: **Concrete**

☐ Parged

☒ **Debris** (not Condition related)

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Deteriorated

☐ Leaks

☐ Debris

**Channel**

Material: **Clay**

☐ Parged

☐ Debris (not Condition related)

Channel Exposure: **Fully Open**

Junc Dist: **0**

nearest .5 ft. Azimuth:

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Deteriorated

☐ Leaks

☐ Debris

**Steps**

Count: **3**

Missing: **2**

☒ **Corroded**

**Surcharge**

☒ **Evidence Of Surcharge**

Depth: **1**

(ft.)

☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S07YY1007MH

Printed On: 12/17/2008

Page 2 of 4

Location View



Top View



Corbel and Barrel infiltration. Corroded and missing steps. Evidence of surcharge - Bench debris.

Defect



Corroded and missign steps.

Defect



Frame leaks. Adjustment deterioration, loose brick and infiltration.

## Manhole Inspection Summary

Manhole # S07YY1007MH

Printed On: 12/17/2008

Page 3 of 4

### 10 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.95** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:


Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 8 in. Circular Gravity Sewer Pipe In @ 3 O'Clock

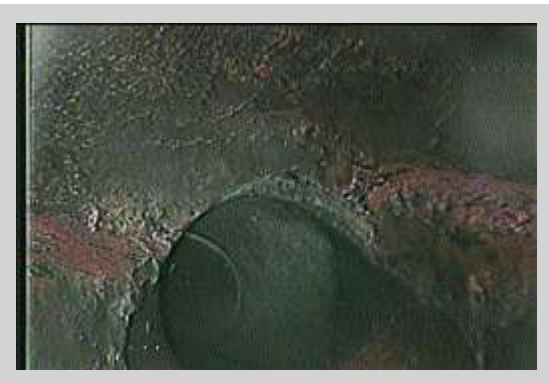

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.75** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Connecting Node Not Available**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S07YY1007MH

Printed On: 12/17/2008

Page 4 of 4

### 8 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.05** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Broken**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 10 in. Circular Gravity Sewer

Pipe In @ 9 O'Clock



Plugged.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.60** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Connecting Node Not Available**

☐ Possible Illicit Connection